



PRODUCT SUPPORT BULLETIN

Title: Heart Rate Combiner Board Trouble Shooting

Date: September 15, 1997	Distribution to:	Written by: Jason Buelna
Bulletin No. 635-0101	<input checked="" type="checkbox"/> Service Providers <input checked="" type="checkbox"/> Product Support <input type="checkbox"/> Star Trac Sales	Approval(s) <u>Signature on file</u>
Revision No. N/A	<input type="checkbox"/> Product Users <input checked="" type="checkbox"/> Distributor	ECO Reference
Date of Last Revision N/A	<input checked="" type="checkbox"/> Manufacturing <input checked="" type="checkbox"/> Engineering	Model(s) Affected

A limited number, of model TR 4000 series with Contact/ Polar Heart Rate, may have been shipped with incorrect integrated circuit U1 installed. If a customer reports that a treadmill provides accurate heart rate at lower levels (120 BPM or less) but that the reading is lost (does not register) when the heart rate exceeds 120 BPM, the incorrect IC may be installed.

To identify which IC the board has, refer to PSB 635-0089.

Incorrect IC number: 74HC132

Correct IC number: 74HCT132

Part number of a new combiner board is 715-3131.