

Seat Latch Not Fitting In Carriage

E- Series Recumbent Bikes

Symptom

There have been reports that the E-series recumbent bike seat latch is slightly large and cannot be inserted into the hole of the carriage (Fig. 1).

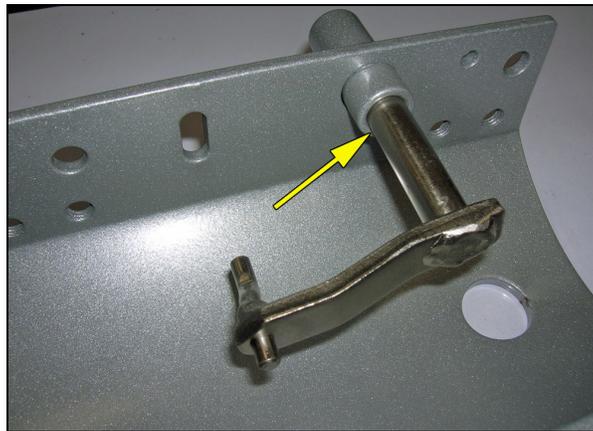


Fig. 1

Cause

There is excess paint inside the hole which will not allow the new latch to fit.

Solution

Use a file (Fig. 2) to remove some of the paint inside the hole (Fig 3).



Fig. 2

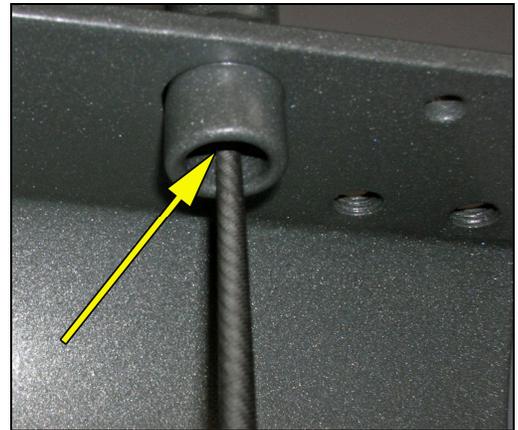


Fig. 3

After the removal of the paint, the seat latch should slide right into the carriage (Fig. 4). If the latch doesn't slide into the carriage without too much force, more filing might be necessary.



Fig. 4